

# AC/DC/IR HIPOT TESTER MODEL19070 & 19050 SERIES

#### **Complete Dielectric Testing Solution**

The Chroma 19050 Series electrical safety testers are advanced digital hipot testers with load and line regulations that help ensure measurement integrity. The Multi-step capability allows users to perform multiple tests in sequence, such as AC hipot followed by IR.

The 19050 Series Hipot Testers have 3 models available for selection: the 19052, 19053, and 19054. The 19052 includes AC/DC hipot testing and IR (Insulation Resistance) measurement while the 19053 provides 8 scan channels for AC/DC hipot testing and IR measurement. The 19054 provides 4 scan channels for AC/DC hipot testing and IR measurement in a single compact unit.

The 19070 Series has 2 models available for selection: the 19071 and the 19073. The 19071 is for AC Hipot testing while the 19073 combines both AC/DC hipot with IR measurement into a single compact unit.

# Open Short Check (OSC)

The OSC function is used to check whether the connection is an open circuit between the instrument and the DUT or if there is a breakdown inside the DUT before testing for electrical safety.

# Flashover (ARC) Detection

The 19070 and 19050 series are sensitive enough to monitor for current spikes even if they do not exceed the maximum trip current level.

#### Ground Continuity Check (GC)

All of the 19070 and 19050 series testers have a ground continuity check feature to determine if the resistance between the ground pin of the power cord and any exposed metal on the product is less than  $1\Omega$ .

#### Ground Fault Interrupt (GFI)

GFI is required by the National Electrical Code in wet locations. Such devices automatically interrupt power when a ground current > 0.5mA exists for more than a few milli-seconds to protect users.

#### **Quick Discharge**

For DC hipot and IR tests, the DUT is discharged back through the HV transformer attaining a rapid and safe discharge.

# GPIB











# MODEL 19070 SERIES 19050 SERIES

#### **KEY FEATURES**

- ACWV/DCWV/IR 3 in 1 hipot tester
- Programmable output voltage to 5kV AC and 6kV DC
- 1kV insulation resistance test
- Insulation resistance measurement from 1M $\Omega$  to 50G $\Omega$
- Ground continuity check (GC)
- Standard RS-232 interface
- Open short check(OSC) function
- GFI shutdown of the instrument when current imbalance > 0.5mA
- Flashover (ARC) detection
- Quick discharge of DUT in IR and DC test
- Pause mode
- UL and TUV approved (\*see spec.)
- CE mark
- Programmable ramp/fall and test time
- Programmable high/low limit
- Save/Recall program test function
- Remote control and interface support






### MAIN FUNCTIONS

#### FLASHOVER DETECTION (ARC)

Fast transients in voltage or current during hipot testing are called electrical flashover. Normally, with AC line frequency (50Hz/60Hz) or DC hipot testing, the leakage current is the same 50Hz/60Hz or DC (charge current excepted). As shown in Figure 1, leakage current varies smoothly.

In contrast, when electrical discharge occurs due to poor insulation materials, electrode gaps, surface clearances, etc., fast transients in leakage current become apparent, as shown in Figure 2. Most of the electrical safety regulations state a necessity of withstand strength test. Nevertheless, general hipot testers only detect the RMS value of leakage current without the capability to detect flashover. Therefore, a hipot tester equipped with FLASHOVER detection function is necessary.

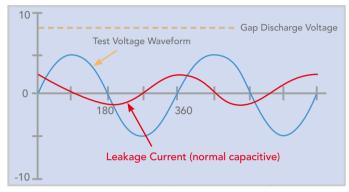

Test Voltage Waveform

Gap Discharge Voltage

180

360

Leakage Current (abnornmal with flashover)


Figure 1: Normal Leakage Current Waveform


Figure 2: Leakage Current Waveform when flahover occurred

## **OPEN/SHORT CHECK (OSC)**

The O.S.C function is used to check whether the circuit connection between the instrument and the DUT (equipment under test) is open or shorted before the electrical safety test begins. Without checking for an open or short, it is possible for the connection to be bad due to a bad lead or relay oxidation, but for the tester to still register a PASS. In some cases, the DUT is shorted before testing. Testing a shorted DUT continually leads to instrument failure due to suffering the high load current. Therefore, it is necessary to check the open and short circuit to ensure the test is effective and protects the instruments.


Normally, a DUT has capacitive loads (Cx) from tens to thousands of pF. If the connection is open, the capacitance will appear and its total capacitive load will be lower than that of normal conditions. If the DUT is shorted, the total capacitive load is higher than that of normal conditions. Therefore, we can measure the value of the capacitive load to check whether the contact is good or not.

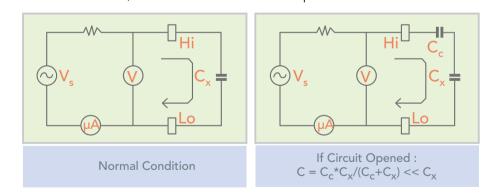

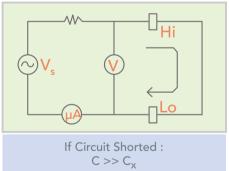


## **GROUND FAULT INTERRUPT (GFI)**

As requirements for test environments state that the test equipment must be equipped with an auto interrupt device, Chroma has embedded Ground Fault Interrupt (GFI) function in the 19050 and 19070 Series testers. When the current meters A1 and A2 detect difference (i2-i1=iH) between the values i1 and the actual i2 test current is too high, the instrument can cut the power immediately to protect the human body. It is not only compliant with the safety standard but also provides more safeguards for testing personnel.

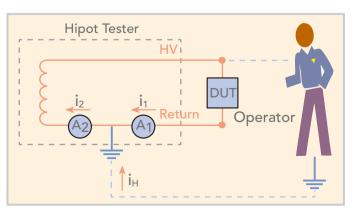


# PANEL DESCRIPTION



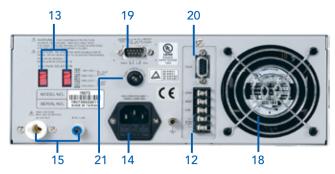



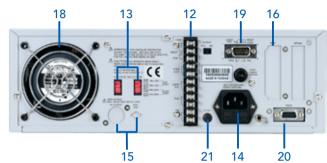

- 1. LINE Switch
- 2. Window Display
- 3. Stop Button
- 4. Start Button
- 5. Function Keys (F1~F4)
- 6. Pass Indicator
- 7. Fail Indicator
- 8. Test Indicator

- 9. HV Output
- 10.RTN/LOW
- 11.8 channels HV Output (19053 only)
- 12.Remote I/O
- 13.LINE Voltage Selector
- 14. Power Cord Receptacle
- 15.Rear HV Output & RTN/LOW

- 16. GPIB/Printer Interface (option)
- 17. Scan Interface (option)
- 18. Fan
- 19. Remote Interface
- 20. RS-232 Interface
- 21. Continuity Test O/P

# **APPLICATIONS**

- Production test for appliances, instruments and information technology equipment in compliance with UL, IEC, TUV and other standards such as EN 60335, EN 60950, EN 61010, CSA C22.2 No.1010.1, UL 3111 and UL 1950
- Transformer electrical safety tests
- Various electronic components tests

# ORDERING INFORMATION

19071 : ACWV Hipot Tester

19073 : ACWV / DCWV / IR Hipot Tester

A190701: Remote control box A190702: 40kV test probe A190704: Start switch A190706: 19" rack mount kit A190708: ARC verification fixture 19052: Hipot Tester (ACWV / DCWV / IR)

19053 : Hipot Tester (ACWV / DCWV / IR / 8CH SCAN) 19054 : Hipot Tester (ACWV / DCWV / IR / 4CH SCAN)

A190344 : HV gun (SP02) A190508 : GPIB interface

A190512: Auto control TR. scan box (Model 19053 only)

A190517: 19" rack mount kit

A190518 : Hipot tester software for 19050 series

SPECIFIC	CATION	IS							
Model			19071		19073	19052	19053	19054	
Mode			ACWV	А	CWV / DCWV / IR	ACWV / DCWV / IR	ACV / DCV		
Scanner Unit			-		-	-	8 ports, ± phase		
Withstandi		ae Test							
Output Vol		9	AC : 0.05 ~ 5kV, DC : 0.05 ~ 6kV						
Load Regulation			≦(1%+5V)						
Voltage Resolotion			2V						
Voltage Accuracy			$\pm$ (1% of reading + 5 counts)						
Cutoff Current			AC: 0.1~20mA	$AC \cdot 0.1 \text{mA} \sim 20 \text{mA}$ $AC \cdot 0.1 \sim 30 \text{m}\Delta$					
			DC: 0.01mA ~ 5mA DC: 0.01 ~ 10mA						
Current Resolution			AC : 1µA, DC : 0.1µA						
Current Accuracy			±(1% of reading + 5 counts)						
Output Frequency			50Hz / 60Hz						
Test Time			0.3 ~ 999 sec., continue						
Ramp Time	9		0.1 ~ 999 sec., off						
Fall Time			0.1 ~ 999 sec., off						
Dwell Time			0.1 ~ 999 sec., off						
Waveform Insulation Resistance			Sine wave						
		:e		1					
Output Voltage			- DC: 0.05 ~ 1kV						
Voltage Resolution			-	- 2V					
Voltage Accuracy			-	=(176 61 1 cading 1 6 counts)					
IR Range	4 00140 07 00110		-		1MΩ~50GΩ		1MΩ~10GΩ		
		1.00MΩ ~ 25.00MΩ	-			$\pm$ (5% of reading + 2% of full scale)			
Resistance Accuracy		22.0 MΩ ~250.0MΩ	-	$\pm$ (4% of reading + 5 counts)					
		0.220G Ω ~1.000G Ω	-			$\pm$ (5% of reading + 2% of full scale)			
		1.000G Ω ~2.500 G Ω	-	$\pm$ (7% of reading + 5 counts) $\pm$ (12% of reading + 5 counts)		$\pm$ (5% of reading + 2% of full scale)			
		2.20G Ω ~10.00G Ω	-			$\pm$ (15% of reading + 1% of full scale)			
		10.00G Ω ~50.00G Ω	-			$\pm$ (15% of reading + 1% of full scale)			
		0.10 ΜΩ ~25.00ΜΩ	-	$\pm$ (7% of reading + 5 counts)		$\pm$ (10% of reading + 2% of full scale)			
		22.0M Ω ~250.0M Ω 0.220 G Ω ~1.000G Ω	<u>-</u>			±(15% of reading + 1% of full scale)			
Flashover (ARC) Detection									
Setting Mo		tection			Pro	grammable setting			
			$\Delta C \cdot 1 \text{m} \Delta \sim 20 \text{m} \Delta$						
Detection Current			AC : 1mA ~ 1	AC : 1mA ~ 20mA DC : 1mA ~ 5mA			AC : 1mA ~ 15mA ; DC : 1mA ~ 10mA		
Secure Pro	tection F	unction	l		DO: IIII/C CIII/C				
Fast Outpu			0.4ms after NG happen						
Ground Fault Interrupt			0.5mA ±0.25mA AC, ON/OFF						
Panel Operation Lock			Present password						
Continuity Check			$1\sim 5\Omega \pm 0.2\Omega$ , ON/OFF $1\Omega \pm 0.2\Omega$ , ON/OFF						
GO/NG Judgment Window									
Indication,			GO : Short sound, Green LED ; NG : Long sound, Red LED						
Data Hold			Least tests data memories						
Memory Storage			10 tests setups with 60 steps pre setup 99 steps or 99 groups for total 500 memory						
Remote &								,	
Remote control			Input : Start, Stop, Interlock (at 11 pin terminal block only) Output : Under test, Pass, Fail						
Communication Interface			RS485 (option) RS232 (standard), GPIB (option)					otion)	
General	acion into			.15 105 (		113232	(O)		
	Environn	nent	Temperature : 0°C~40°C ; Humidity : 15% to 95% R.H @ ≦40°C						
Operation Environment Power Requirements			100V/120V/220V/240V (AC ±10%), 50/60Hz						
Power Consumption			300W 500W						
Dimension (W x H x D)			270x105x350 mm/10.63x4.13x13.78 inch			320 x 105 x 400 mm/12.6x4.13x15.75 inch			
Weight			11 kg / 24.23 lbs			Approx. 15.4 kg / 33.92 lbs			
Certification									
Certificatio	71 T		UL, TUV, CE UL, TUV, CE CE UL, TUV, CE						

<sup>\*</sup>All specifications are subject to change without notice.

#### Get more product & distributor information in Chroma ATE APP







Search Keyword

19070 or 19050

**HEADQUARTERS** CHROMA ATE INC. 66 Huaya 1st Road, Guishan, Taoyuan 33383, Taiwan T +886-3-327-9999 F +886-3-327-8898 www.chromaate.com info@chromaate.com **CHROMA SYSTEMS** SOLUTIONS, INC. 19772 Pauling, Foothill Ranch, CA 92610 T +1-949-600-6400 F +1-949-600-6401 www.chromausa.com sales@chromausa.com **EUROPE** CHROMA ATE EUROPE B.V. Morsestraat 32, 6716 AH Ede, The Netherlands T +31-318-648282 F +31-318-648288 www.chromaeu.com sales@chromaeu.com

CHROMA GERMANY GMBH Südtiroler Str. 9, 86165, Augsburg, Germany T +49-821-790967-0 F +49-821-790967-600 www.chromaeu.com sales@chromaeu.com

**JAPAN** CHROMA JAPAN CORP. 888 Nippa-cho, Kouhoku-ku, Yokohama-shi, Kanagawa, 223-0057 Japan T +81-45-542-1118 F +81-45-542-1080 www.chroma.co.jp info@chroma.co.jp

KOREA CHROMA ATE KOREA BRANCH 3F Richtogether Center, 14, Pangyoyeok-ro 192, Bundang-gu, Seongnam-si, Gyeonggi-do 13524, Korea T +82-31-781-1025 F +82-31-8017-6614 www.chromaate.co.kr info@chromaate.com

**CHINA** CHROMA ELECTRONICS QUANTEL PTE LTD. (SHENZHEN) CO., LTD. 8F, No.4, Nanyou Tian An Industrial Estate, Shenzhen, China T +86-755-2664-4598 F +86-755-2641-9620 www.chroma.com.cn info@chromaate.com

SOUTHEAST ASIA (A company of Chroma Group) 46 Lorong 17 Geylang # 05-02 Enterprise Industrial Building, Singapore 388568 T +65-6745-3200 F +65-6745-9764 www.quantel-global.com sales@quantel-global.com